
## \*\*\*\*THIS IS A NEW APPENDIX. - PLEASE READ CAREFULLY.\*\*\*\*

# BRANDS USED ON WOOD PRODUCTS TYPICAL IDENTIFICATION BRAND & KEY 1

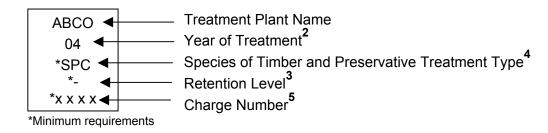

#### **Species**

DF – Douglas Fir

SP - Southern (Yellow) Pine

## **Preservative Treatment Type**

C - Creosote

PA - Pentachlorophenol in Petroleum

PC - Pentachlorophenol in Light Hydrocarbon Solvent

SB – Ammoniacal Copper Arsenate (ACA)

SZ – Ammoniacal Copper Zinc Arsenate (ACZA)

SC – Chromated Copper Arsenate (CCA – A)

SJ – Chromated Copper Arsenate (CCA – B)

SK – Chromated Copper Arsenate (CCA – C)

### **Retention Level**

Minimum Retention of Preservative pcf (Kg/m<sup>3</sup>)

Material and Usage	Creosote	Penta	ACA	ACZA	CCA (SYP only)	AWPA C Standard
Lumber and Timber	12 (192)	0.6 (9.6)	0.6 (9.6)	0.6 (9.6)	0.6 (9.6)	C2,
PILES: Southern Yellow Pine	12 (192) SYP	-	-	-	-	C3,
Douglas Fir	12 (192) DF	-	-	-	-	C3,
Post, Fence, Guide, Sign (Round)	-	0.3 (4.8)	0.4 (6.4)	0.4 (6.4)	0.4 (6.4)	C5,
Post, Fence, Guide, Sign (Sawed)	-	0.4 (6.4)	0.5 (8)	0.5 (8)	0.5 (8)	C2,
Post, Guardrail, Spacer Blocks (Sawed)	-	0.4 (6.4)	0.6 (9.6)	0.6 (9.6)	0.6 (9.6)	C2,

<sup>1</sup> This information may be placed on the material by heat branding, hammer stamping or metal tagged in any order. For material treated with waterborne preservatives, the identification mark may be ink stamped, provided the information is clearly visible and legible.

May also include month as in "10-04."

<sup>&</sup>lt;sup>3</sup> Retention shall be determined by assay. Place letter "A" after number.

Full names or abbreviations shown or trade names may be used for preservatives instead of the recommended standard symbol if desired.

<sup>&</sup>lt;sup>5</sup> The charge number may be added at a later step.